
TROUBLE DIAGNOSIS

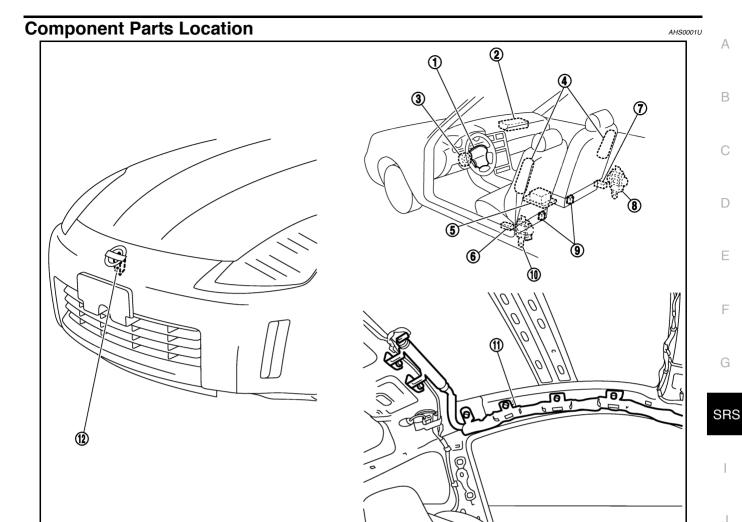

- Driver air bag module
- Front side air bag module
- Side air bag (Satellite) sensor RH
- 10. Seat belt pre-tensioner LH
- *: For Coupe

- 2. Front passenger air bag module
- 5. Diagnosis sensor unit
- 8. Seat belt pre-tensioner RH
- 11. Side curtain air bag module*
- 3. Spiral cable
- 6. Side air bag (Satellite) sensor LH

PHIA0160E

- 9. Seat belt buckle switches
- 12. Crash zone sensor

M

Κ


В

D


Е

G

SRS-9 2005 350Z Revision: 2005 August

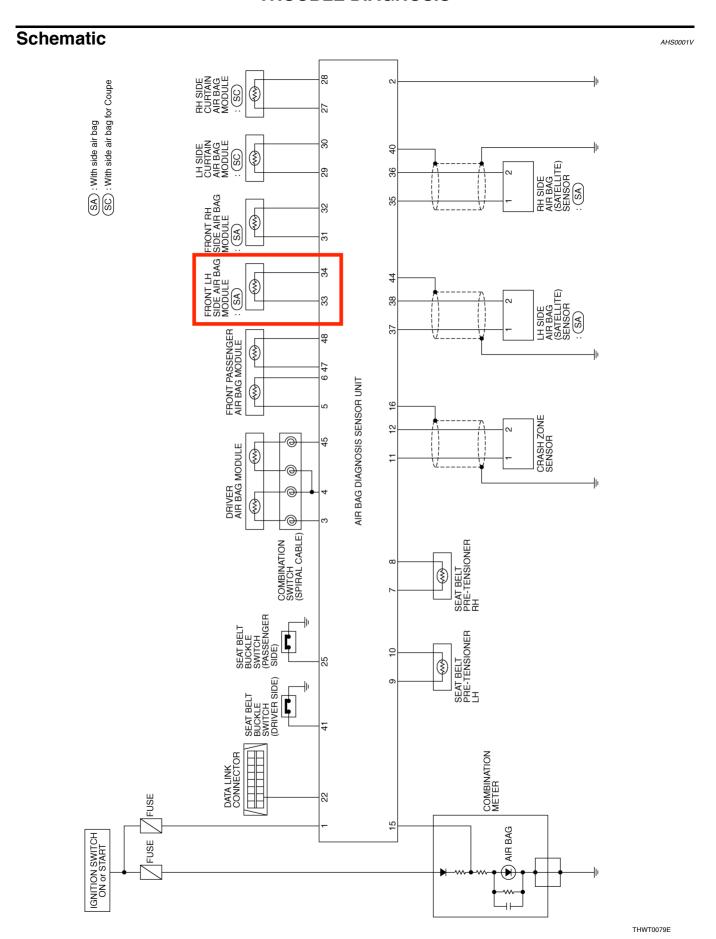

TROUBLE DIAGNOSIS

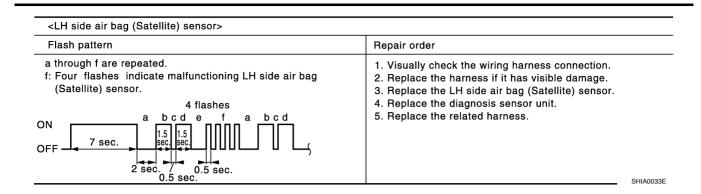

<front air="" bag="" module="" rh="" side=""></front>		_
Flash pattern	Repair order	
a through f are repeated. f: One flash indicates malfunctioning front RH side air bag module circuit.	Visually check the wiring harness connection. Replace the harness if it has visible damage. Replace the related harness.	
ON 1 flash a b c d e f a b c d 7 sec. 2 sec. 7 0.5 sec. 2 sec. 0.5 sec.		PHIA1237E

Flash pattern	Repair order	
a through f are repeated. f: Two flashes indicate malfunctioning front LH side air bag module circuit. 2 flashes 2 flashes 3 b c d e f a b c d 2 sec. 0.5 sec. 2 sec.	Visually check the wiring harness connection. Replace the harness if it has visible damage. Replace the related harness.	PHIA1238F

<rh air="" bag="" curtain="" module="" side=""></rh>	
Flash pattern	Repair order
a through f are repeated. f: Five flashes indicate malfunctioning RH side curtain air bag module circuit.	Visually check the wiring harness connection. Replace the harness if it has visible damage. Replace the related harness.
ON 7 sec. 7 sec. 7 0.5 sec. 2 sec. 2 sec.	PHIA1240E